

# MARION COUNTY SURVEYOR'S OFFICE


## SECTION CORNER RECORD

DEBRA S. JENKINS  
MARION COUNTY SURVEYOR

SEC. 5 TWN. 14<sub>N</sub> RNG. 5<sub>E</sub>

BRYAN F. CATLIN, PLS  
TECHNICAL SUPERVISOR

Date: 8-12-09  
Party Chief: Wilcoxen  
Crew: Finney  
Type of Marker: 5/8" Rebar  
Method of Establishment: County: 5-13-1983  
IN S.P.C. E Zone, NAD 83  
Name: 14050502  
N: 493 860.444 6(m)  
E: 71 485.495 7(m)

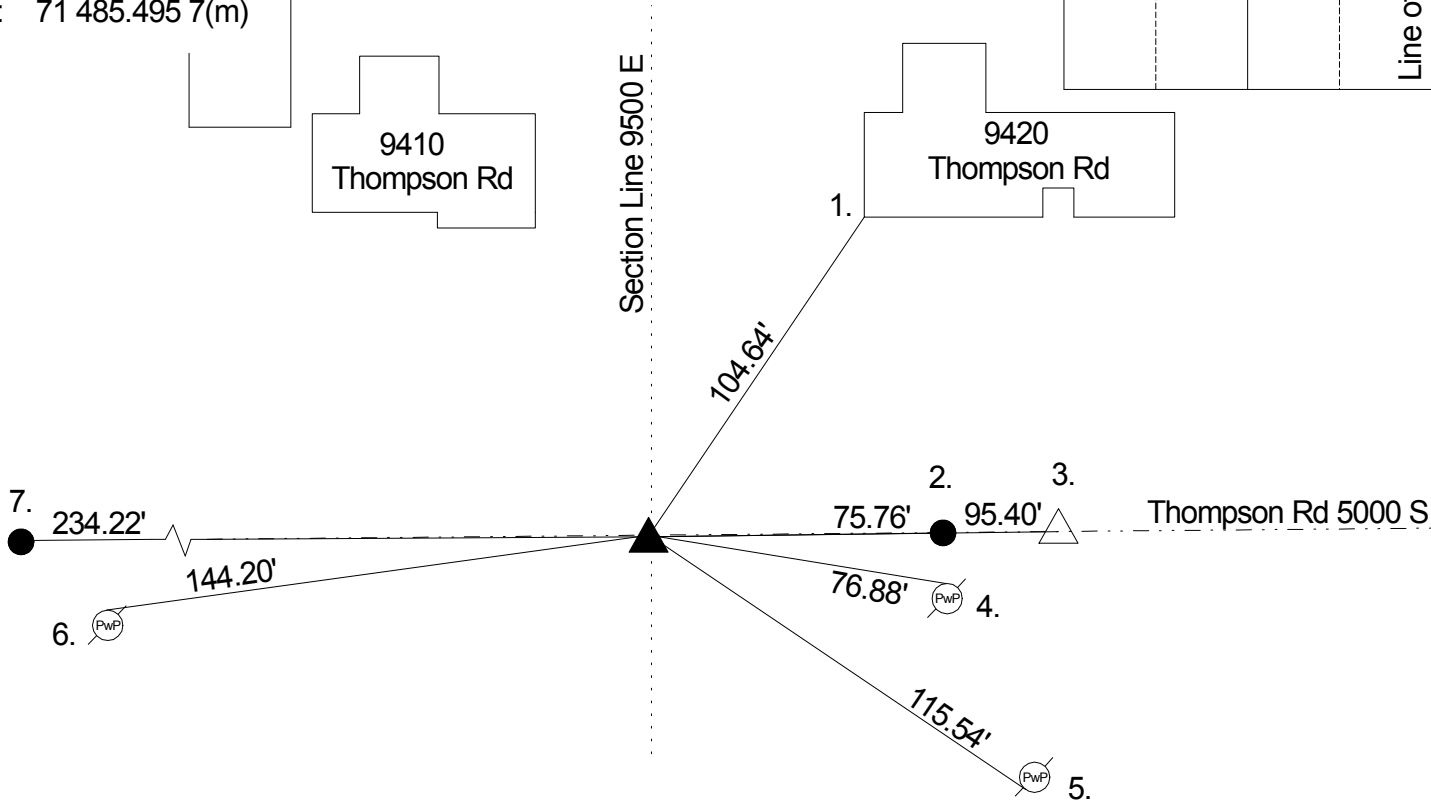

In May of 1983, Wilcoxen set rebar as corner. It was found that the stone previously tied as the north quarter corner of Sec. 5 was a property corner stone set in May 1916 at the Northeast corner of the McCorkle property (see Franklin Township Legal Book p. 66) Said stone had been referenced as the North quarter of Sec. 5 since at least June 12, 1962, and also on 10-15-74 by Fortner. We dug that location and verified that there is, in fact, a stone there. We then dug 310' west at the Northwest corner of the small trapezoidal shaped tract (said legal survey indicates a stone at that location) and found the stone there also. The distances checked within 0.02' with the legal survey distance. We then measured west to the ¼ ¼ corner (Northwest corner of the Toon tract on said Legal survey, labeled stone) and dug that location. We found that stone also and the distance from the last aforementioned stone checked within 0.08 feet with the legal survey distance. To locate the correct position of the north quarter corner of Sec. 5 we used the Township line as established between the southwest and south quarter corners of Sec 32-15-5 for line and we doubled the distance between the NW corner of Sec. 5 and the aforesaid ¼ ¼ corner stone. Several items need to be mentioned. The falling at the NW corner of Sec. 5 has been found to be 139.30' in the field versus 127.38' in the original notes. If the record falling (127.38') had been used to establish the NW corner of Sec. 5, the resulting North ¼ corner position (arrived at by doubling the ¼ ¼ distance) would fall 11.92 feet west of the position arrived at by using the NW corner of Sec. 5 as we have it located (139.30' falling). We dug both locations and did not find any surface or subsurface markers at either location. Our final location was arrived at using the NW corner of Sec. 5. per our ties (139.30' falling). Note, also, that two of the distances indicated along the North line of Sec 5 on the above mentioned survey are misplaced. The 1211.76' distance at the NE corner of the McCorkle tract should be at the NW corner of said tract and the 1116.72' distance at the NW corner of the McCorkle tract should be at the stone at the NW corner of the small trapezoidal shaped tract. Note, finally, that the three stones found per the aforementioned legal survey do not fall on the township line as established between the Southwest and South quarter corners of Sec 32-15-5. The ¼ ¼ stone falls 1.08' north, the stone 234.22' west of the North quarter corner of Sec. 5 falls 0.34' south and the stone 94.68' east of North quarter corner falls 0.12' south of the township line. 1-6-1994 Whiteside retied. 7-22-1998 Wilcoxen retied. 10-15-2002 Wilcoxen retied. 8-12-09 Wilcoxen retied.

REF.	DISTANCE	DESCRIPTION
1.	104.64'	SW corner of foundation 9420 Thompson Rd
2.	75.76'	Due E to NE corner of "McCorkle" survey (Franklin Legal Book pg. 66) (Mag nail w/brass washer over stone)
3.	95.40'	Due E to South Quarter of 32-15-5 - Harrison
4.	76.88'	PK nail N PwP #88-711 BB 10" up
5.	115.54'	PK nail SW PwP no # 15" up
6.	144.20'	PK nail N PwP #2-711 A 10" up
7.	234.22'	Due W to NW corner of "McCorkle" survey (Franklin Township Legal Survey book p. 66) (stone)